

PLAN: TREE REMOVAL, PROTECTION AND MITIGATION PLAN

SCALE: 1" = 100'

CONTACT INFORMATION:
ARBORIST:
 ALTAR TREE SERVICE (ATTN: WILL FARGO, ISA CERTIFIED ARBORIST)
 INDEPENDENCE OR 97351
 TEL (971) 301-5035
 ALTARTREESERVICE@GMAIL.COM
REPRESENTATIVE/CONTACT:
 HAYWARD USKOSKI AND ASSOCIATES (ATTN: THOMAS ELLIS)
 1101 BROADWAY ST #130
 VANCOUVER WA 98660
 TEL (360) 635-5223
 THOMAS@HUACONSULTING.COM

NOTE: THIS PLAN SCHEMATIC ONLY. FINAL LANDSCAPE PLANS (BY OTHERS) TO BE PROVIDED FOR ALL PLANTING INFORMATION AND IRRIGATION APPURTENANCES

TREE PROTECTION PLAN NOTES


- TREE CONDITIONS LISTED ON SHEET 6 FOLLOW THE FOLLOWING DEFINITIONS:
 "GOOD" HEALTH IS DEFINED AS TREES WITH GOOD HEALTH AND STRUCTURAL STABILITY THAT HAVE THE POTENTIAL FOR LONGEVITY AT THE SITE
 "MODERATE" HEALTH IS DEFINED AS TREES IN FAIR HEALTH AND/OR POSSESSING STRUCTURAL DEFECTS THAT MAY BE ABATED WITH TREATMENT. TREES IN THIS CATEGORY REQUIRE MORE INTENSE MANAGEMENT AND MONITORING AND MAY HAVE SHORTER LIFE-SPANS THAN THOSE IN THE GOOD CATEGORY.
 "POOR" HEALTH IS DEFINED AS TREES IN POOR HEALTH OR POSSESSING SIGNIFICANT DEFECTS IN STRUCTURE THAT CANNOT BE ABATED WITH TREATMENT. THESE TREES ARE EXPECTED TO DECLINE REGARDLESS OF MANAGEMENT. THE SPECIES OR INDIVIDUAL TREE MAY POSSESS EITHER CHARACTERISTICS THAT ARE UNDESIRABLE IN LANDSCAPE SETTINGS OR BE UNSUITED FOR USE AREAS.
- TREES RETAINED SHALL BE PROTECTED WITH MEASURES SUCH AS TEMPORARY AND PERMANENT FENCING AT THE TREE PROTECTION ZONE OR DRIPLINE AND AT THE BOUNDARY OF OPEN SPACE TRACTS. PRELIMINARY TEMPORARY FENCE LOCATION SHOWN ON PLAN AROUND TREES TO BE PROTECTED. SPLIT RAIL FENCING MAY BE USED IN LIEU OF CHAINLINK FENCING.
- EXISTING TREES FOUND ON SITE AND DESCRIBED ON SHEET 6 ARE WITHIN THE DEVELOPMENT ENVELOPE OF THE PROPOSED IMPROVEMENTS ARE TO BE REMOVED WITH THE DEVELOPMENT AT THE TIME OF MASS GRADING AND IMPROVEMENTS UNLESS NOTED OTHERWISE ON PLAN (EST. SUMMER 2022)
- TREES OUTSIDE OF DEVELOPMENT ENVELOPE (SUCH AS WITHIN RIPARIAN HABITAT AREAS) OR OFFSITE TO BE RETAINED AND PROTECTED DURING DEVELOPMENT. SEE NOTE 2.
- TREE REMOVAL OCCURRING TO ALLOW FOR MASS GRADING AND INSTALLATION OF DEVELOPMENT ITEMS SUCH AS ROADS, UTILITIES AND HOMES.
- PROPOSED LANDSCAPING SHOWN ON LANDSCAPE ARCHITECTS PLAN FOR THE PARK AREA IN THE SOUTHEAST CORNER OF THE SITE.
- ADDITIONAL LANDSCAPING EXCEEDING CITY REQUIREMENTS MAY BE CONSTRUCTED WITH THE SUBDIVISION.

STREET TREE NOTES

- STREET TREES TO BE PLANTED AT 30' O.C. AT THE TIME OF OCCUPANCY.
- THE CONTRACTOR/OWNER SHALL BE RESPONSIBLE FOR MAINTAINING THE HEALTH OF ALL STREET TREES ASSOCIATED WITH THIS PROJECT BY WATERING, PRUNING AND ALL OTHER NECESSARY CARE UNTIL THE RIGHT-OF-WAYS ARE DEDICATED TO THE CITY OF LA CENTER.
- TREES TO BE INSTALLED PER THE REQUIREMENTS OF 18.340. ALL STREET TREES SHALL BE A MINIMUM OF 2" CALIPER DBH FOR DECIDUOUS OR 8 FT TALL FOR EVERGREEN AT TIME OF PLANTING.
- LANDSCAPING SHALL BE PRUNED, WATERED, FERTILIZED AND MAINTAINED IN A HEALTHY CONDITION BY OCCUPANTS AND HOA.
- APPROXIMATE LOCATIONS FOR TREES ARE SHOWN ON THE PLAN. EXACT LOCATIONS TO BE DETERMINED BY THE DEVELOPER OR BUILDER AFTER CONSTRUCTION OF DRIVEWAYS, SIDEWALKS AND BUILDINGS. TREES SHALL BE PLACED IN LOCATIONS TO AVOID SANITARY AND WATER SERVICES. MINIMUM SEPARATION FROM UTILITY SERVICES SHALL BE 5'.
- THE FOLLOWING LIST PROVIDES PROPOSED STREET TREE VARIETIES. FINAL TREE SPECIES USED MAY VARY FROM THE BELOW LIST, DEPENDING ON AVAILABILITY:
 - PAPERBARK MAPLE (ACER GRISEUM)
 - AMERICAN HORNBEAM (CARPINUS CAROLINIA)
 - LAVELLE HAWTHORN (CRATAEGUS x LAVALLEI)
 - TRIDENT MAPLE (ACER BUERGERANUM)
 - CELESTIAL DOGWOOD (CARNUS x RUTDAN)
 - CITY SPRITE ZELKOVA (ZELKOVA SERRATA 'JFS-KW')
 - FLAME MAPLE (ACER GINNALA 'FLAME')
 - BLUE DUNE LYME GRASS (ELYMUS ARENARIUS)


EX. TREE LEGEND

- DF - DOUGLAS FIR (PSEUDOTSUGA MENZIESII)
- NS - NORWAY SPRUCE (PICEA ABIES)
- OW - OREGON WHITE OAK (QUERCUS GARRYANA)
- SB - SILVER BIRCH (BETULA SPP)
- SC - SWEET CHERRY (PRUNUS AVIUM)
- CB - COMMON BUCKTHORN (RHAMNUS CATHARTICA)
- RC - RED CEDAR (THUJA PLICATA)
- GF - GRAND FIR (ABIES GRANDIS)
- PA - POPULUS ALDER (GENUS ALDUS)
- BP - BALSAM FIR (ABIES BALSAMEA)
- VM - VINE MAPLE (ACER VINUS)
- JM - JAPANESE MAPLE (ACER PALMATUM)
- RW - RED WILLOW (SALIX PSS AVIUM)
- PP - PONDEROSA PINE (PINUS PONDEROSA)
- CO - CO-DOMINANT

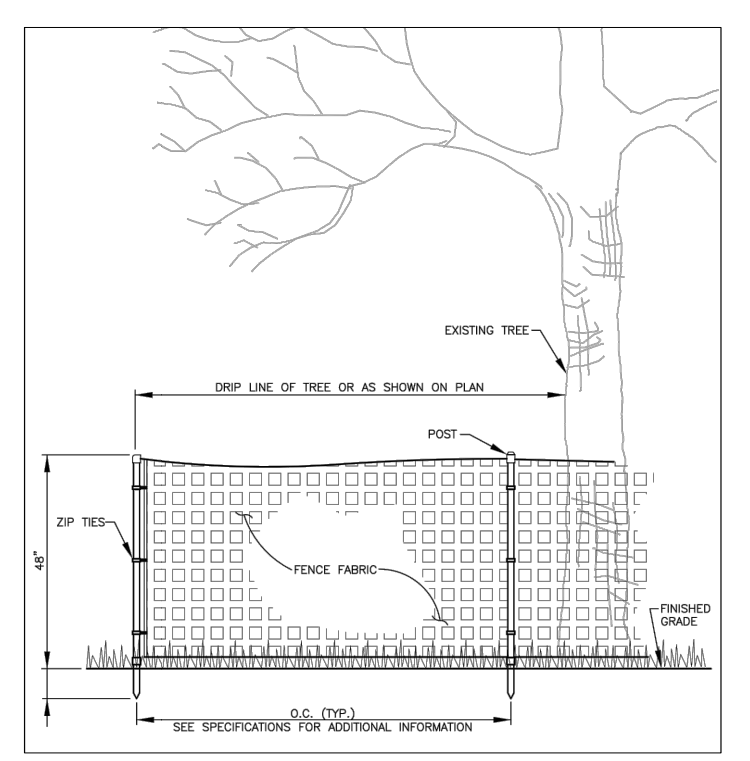


DETAIL: TEMP TREE PROTECTION

SCALE: N.T.S.

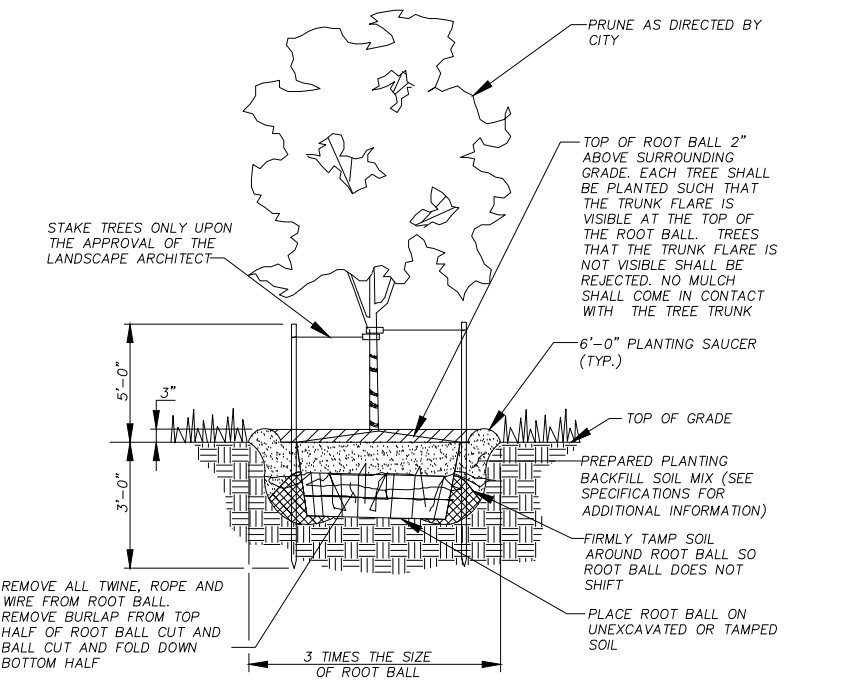

DETAIL: TREE INSTALLATION

SCALE: N.T.S.

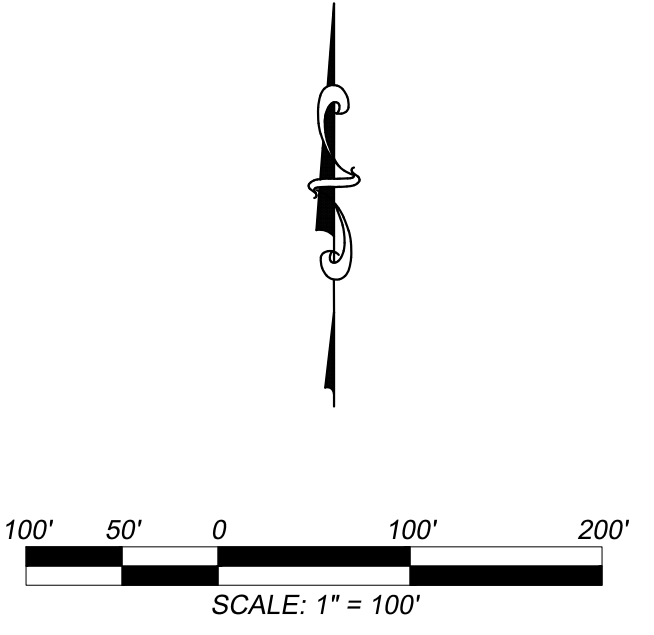

#	Location	Species	Common Name	DBH (in)	Condition	Notes
1	Red	<i>Abies grandis</i>	Grand Fir	19	Good	Furthest NE from house, three tree cluster
2	Red	<i>Pseudotsuga menziesii</i>	Douglas Fir	16	Good	Furthest NE from house, three tree cluster
3	Red	<i>Picea pungens</i>	Blue Spruce	16	Good	Furthest NE from house, three tree cluster
4	Red	<i>Pseudotsuga menziesii</i>	Douglas Fir	23	Good	E of house
5	Red	<i>Pseudotsuga menziesii</i>	Douglas Fir	28	Good	E of house
6	Red	<i>Picea pungens</i>	Blue Spruce	18	Good	Directly NE from house
7	Red	<i>Pseudotsuga menziesii</i>	Douglas Fir	25	Good	E of house
8	Red	<i>Pseudotsuga menziesii</i>	Douglas Fir	23	Good	NE of house
9	Red	<i>Pseudotsuga menziesii</i>	Douglas Fir	22	Good	E of house
10	Red	<i>Pseudotsuga menziesii</i>	Douglas Fir	28	Good	NE of house
11	Red	<i>Pseudotsuga menziesii</i>	Douglas Fir	25	Good	E of house
12	Red	<i>Pseudotsuga menziesii</i>	Douglas Fir	30	Good	E of house
13	Red	<i>Pseudotsuga menziesii</i>	Douglas Fir	24	Good	E of house
14	Red	<i>Prunus avium</i>	Sweet Cherry	18	Poor	E of house
15	Red	<i>Acer platanoides</i>	Norway Maple	10	Good	NW of house
16	Red	<i>Acer platanoides</i>	Norway Maple	11	Good	NW of house, 10 stem
17	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	22	Good	Row along driveway, W of house
18	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	15	Good	Row along driveway, W of house
19	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Row along driveway, W of house
20	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	18	Good	Row along driveway, W of house
21	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	18	Good	Row along driveway, W of house
22	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	17	Good	Row along driveway, W of house
23	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	16	Good	Row along driveway, W of house
24	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	16	Good	Row along driveway, W of house
25	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Codominant (13" & 15" trunks)
26	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	24	Good	Row along driveway, W of house
27	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	19	Good	Row along driveway, W of house
28	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Codominant (15" & 12" trunks)
29	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	11	Good	Row along driveway, W of house
30	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	17	Good	Row along driveway, W of house
31	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	12	Good	E of house
32	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	10	Good	E of house
33	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	9	Good	Codominant (9" & 9" trunks)
34	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	9	Good	E of house
35	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	28	Good	E of house
36	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	28	Good	E of house
37	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	16	Good	E of house
38	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	E of house
39	Yellow	<i>Pseudotsuga menziesii</i>	Douglas Fir	16	Good	E of house
40	Yellow	<i>Betula pendula</i>	Common Birch	12	Good	W of house
41	Yellow	<i>Betula pendula</i>	Common Birch	14	Good	SW of house. Codominant (14" & 14" trunks)
42	Yellow	<i>Acer platanoides</i>	Norway Maple	16	Moderate	SW of house
43	Yellow	<i>Acer platanoides</i>	Norway Maple	16	Good	NW of house
44	Yellow	<i>Picea pungens</i>	Blue Spruce	12	Good	Corner of E driveway and 348th St
45	Yellow	<i>Picea pungens</i>	Blue Spruce	9	Good	Corner of east driveway and 348th St
46	Yellow	<i>Picea pungens</i>	Blue Spruce	12	Good	Corner of east driveway and 348th St
47	Blue	<i>Abies grandis</i>	Grand Fir	12	Good	N of vacant house
48	Blue	<i>Populus tremuloides</i>	Quaking Aspen	17	Moderate	NE of vacant house (Codominant (17" & 17" trunks)
49	Blue	<i>Populus tremuloides</i>	Quaking Aspen	16	Moderate	NE of vacant house
50	Blue	<i>Alnus rubra</i>	Red Alder	14	Moderate	NW of vacant house (Co-Dominant: 14" & 14" trunks)
51	Blue	<i>Prunus avium</i>	Sweet Cherry	27	Poor	S of 348th St
52	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	13.5	Good	Row of fir trees along N property line
53	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	16	Good	Row of fir trees along N property line
54	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	12	Good	Row of fir trees along N property line
55	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	10	Good	Row of fir trees along N property line
56	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	16	Good	Row of fir trees along N property line
57	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	10	Good	Row of fir trees along N property line
58	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	11	Good	Row of fir trees along N property line
59	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	10	Good	Row of fir trees along N property line
60	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	11	Good	Codominant (11" & 11" trunks)

61	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	12	Good	Row of fir trees along N property line
62	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	10	Good	Row of fir trees along N property line
63	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	13	Good	Row of fir trees along N property line
64	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	12	Good	Row of fir trees along N property line
65	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	12	Good	Row of fir trees along N property line
66	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	13	Good	Row of fir trees along N property line
67	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	12	Good	Row of fir trees along N property line
68	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	12	Good	Row of fir trees along N property line
69	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Row of fir trees along N property line
70	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	11	Good	Row of fir trees along N property line
71	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Row of fir trees along N property line
72	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Row of fir trees along N property line
73	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	13	Good	Row of fir trees along N property line
74	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	13	Good	Row of fir trees along N property line
75	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Row of fir trees along N property line
76	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	12	Good	Row of fir trees along N property line
77	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	12	Good	Row of fir trees along N property line
78	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	12	Good	Row of fir trees along N property line
79	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	12	Good	Row of fir trees along N property line
80	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	16	Good	Row of fir trees along N property line
81	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	17	Good	Row of fir trees along N property line
82	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Row of fir trees along N property line
83	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Row of fir trees along N property line
84	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Row of fir trees along N property line
85	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	15	Good	Row of fir trees along N property line
86	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Row of fir trees along N property line
87	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Row of fir trees along N property line
88	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	12	Good	Row of fir trees along N property line
89	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	13	Good	Row of fir trees along N property line
90	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	16	Good	Row of fir trees along N property line
91	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Row of fir trees along N property line
92	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Row of fir trees along N property line
93	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Row of fir trees along N property line
94	Blue	<i>Pseudotsuga menziesii</i>	Douglas Fir	16	Good	Row of fir trees along N property line
95	Orange	<i>Quercus garryana</i>	Oregon White Oak	7	Moderate	At site entrance
96	Orange	<i>Pseudotsuga menziesii</i>	Douglas Fir	4	Good	At site entrance
97	Orange	<i>Prunus avium</i>	Sweet Cherry	5	Poor	At site entrance
98	Orange	<i>Prunus Avium</i>	Sweet Cherry	14	Poor	NW of site entrance
99	Orange	<i>Pseudotsuga menziesii</i>	Douglas Fir	44	Good	NW of site entrance
100	Orange	<i>Malus spp.</i>	Apple	5	Poor	Multistem, N fence line
101	Orange	<i>Quercus garryana</i>	Oregon White Oak	7	Moderate	At site entrance
102	Orange	<i>Malus spp.</i>	Apple	5	Poor	Multistem, N fence line
103	Orange	<i>Malus spp.</i>	Apple	15	Poor	SE of property
104	Green	<i>Thuja plicata</i>	Western Red Cedar	19	Good	Row along NW 348th St
105	Green	<i>Pseudotsuga menziesii</i>	Douglas Fir	8	Poor	Row along NW 348th St
106	Green	<i>Pseudotsuga menziesii</i>	Douglas Fir	6	Poor	Row along NW 348th St
107	Green	<i>Pseudotsuga menziesii</i>	Douglas Fir	10	Good	Row along NW 348th St
108	Green	<i>Pseudotsuga menziesii</i>	Douglas Fir	11	Good	Row along NW 348th St
109	Green	<i>Pseudotsuga menziesii</i>	Douglas Fir	9	Good	Row along NW 348th St
110	Green	<i>Abies grandis</i>	Grand Fir	11	Poor	Row along NW 348th St

111	Green	<i>Pseudotsuga menziesii</i>	Douglas Fir	9	Good	Row along NW 348th St
112	Green	<i>Pseudotsuga menziesii</i>	Douglas Fir	9	Good	Row along NW 348th St
113	Green	<i>Pseudotsuga menziesii</i>	Douglas Fir	7	Good	Row along NW 348th St
114	Green	<i>Pseudotsuga menziesii</i>	Douglas Fir	7	Good	Row along NW 348th St
115	Green	<i>Pseudotsuga menziesii</i>	Douglas Fir	8	Good	Row along NW 348th St
116	Green	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Row along NW 348th St
117	Green	<i>Thuja plicata</i>	Western Red Cedar	7	Good	Co-dominant (6" & 8" DBH)
118	Green	<i>Thuja plicata</i>	Western Red Cedar	12	Poor	Row along NW 348th St
119	Green	<i>Thuja plicata</i>	Western Red Cedar	15	Good	Row along NW 348th St
120	Green	<i>Pseudotsuga menziesii</i>	Douglas Fir	10	Good	Row along NW 348th St
121	Green	<i>Thuja plicata</i>	Western Red Cedar	15	Good	Row along NW 348th St
122	Green	<i>Thuja plicata</i>	Western Red Cedar	12	Good	Codominant (11" & 12" DBH)
123	Green	<i>Pseudotsuga menziesii</i>	Douglas Fir	6	Poor	Row along NW 348th St
124	Green	<i>Pseudotsuga menziesii</i>	Douglas Fir	5	Poor	Row along NW 348th St
125	Green	<i>Thuja plicata</i>	Western Red Cedar	16	Good	Row along NW 348th St
126	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	6	Good	Row along N property line
127	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	5	Good	Row along N property line
128	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	36	Good	Row along N property line
129	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	10	Good	Row along N property line
130	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	7	Good	Row along N property line
131	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	5	Good	Co-dominant (6" & 3")
132	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	11	Good	Row along N property line
133	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	11	Good	Row along N property line
134	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	11	Good	Row along N property line
135	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	10	Good	Row along N property line
136	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	11	Good	Row along N property line
137	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	12	Good	Row along N property line
138	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	14	Good	Row along N property line
139	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	7	Good	Row along N property line
140	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	15	Good	Row along N property line
141	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	16	Good	Row along N property line
142	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	14	Good	Row along N property line
143	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	13	Good	Row along N property line
144	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	10	Good	Row along N property line
145	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	15	Good	Row along N property line
146	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	13	Good	Row along N property line
147	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	13	Good	Row along N property line
148	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	18	Good	Row along N property line
149	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	11	Good	Row along N property line
150	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	15	Good	Row along N property line
151	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	13	Good	Row along N property line
152	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	14	Good	Row along N property line
153	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	10	Poor	Row along N property line
154	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	18	Moderate	Row along N property line
155	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	10	Good	Row along N property line
156	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	15	Good	Row along N property line
157	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	16	Good	Row along N property line
158	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	11	Good	Row along N property line
159	Pink	<i>Pinus ponderosa</i>	Ponderosa Pine	14	Good	Row along N property line
160	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	18	Good	Row along N property line
161	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	9	Poor	Row along N property line
162	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	8	Poor	Dead
163	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	7	Moderate	Row along N property line
164	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	13	Good	Row along N property line
165	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	8	Good	Row along N property line
166	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	13	Good	Row along N property line
167	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	15	Good	Row along N property line
168	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	28	Poor	Dead/Dying
169	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	6	Poor	Dead/Dying
170	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Row along N property line
171	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	13	Good	Row along N property line
172	Pink	<i>Pseudotsuga menziesii</i>	Douglas Fir	14	Good	Row along N property line


CONTACT INFORMATION:

ARBORIST:
 ALTAR TREE SERVICE (ATTN: WILL FARGO, ISA CERTIFIED ARBORIST)
 INDEPENDENCE OR 97351
 TEL (971) 301-5035
 ALTARTREESERVICE@GMAIL.COM

REPRESENTATIVE/CONTACT:
 HAYWARD USKOSKI AND ASSOCIATES (ATTN: THOMAS ELLIS)
 1101 BROADWAY ST #130
 VANCOUVER WA 98660
 TEL (360) 635-5223
 THOMAS@HUACONSULTING.COM



ALTAR
 TREE SERVICE

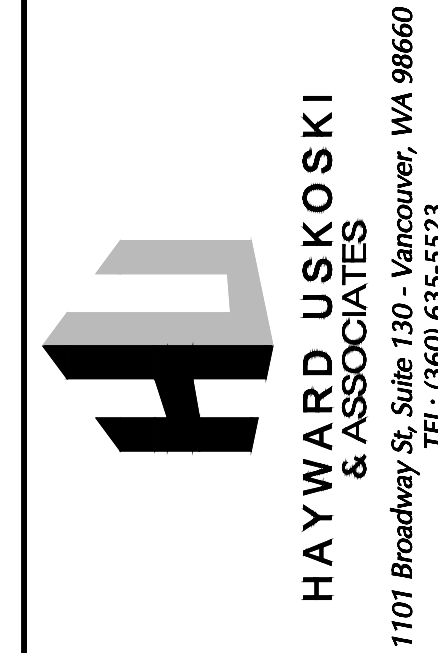

HAYWARD USKOSKI & ASSOCIATES
 1101 Broadway St, Suite 130 - Vancouver, WA 98660
 TEL: (360) 635-5223

**STEPHENS HILLSIDE FARM
 LA CENTER WA
 POST DECISION REVIEW
 TREE LIST**

REV	DATE	DESCRIPTION